



CONSTRUCTION CONSULTING & TESTING, INC.

TOLEDO OFFICE - 700 S. River Road Waterville, Ohio 43566 Ph.: (419) 878-7304
DETROIT OFFICE - 35410 Mound Rd. Sterling Hts., Michigan 48310 Ph.: (586) 795-2877

Client: Century Cement
12670 Sibley Road
Riverview, MI 48193

Project: PW 7023

MDOT:

Date: August 6, 2021

CCT No.: 201-20086-17A

REPORT OF CONCRETE COMPRESSIVE STRENGTH

DATE OF POUR: 7/30/2021

LOCATION OF POUR: Sidewalk: Conner & Warren

SUPPLIER: Hercules

TICKET NO.: 424740

MIX I.D.: P1-DETM-1

FIELD DATA: Set 1 of 2

DATE: 7/30/2021

BATCH TIME: 6:44 AM

TEST TIME: 9:30 AM

AIR CONTENT (%): 6.8%

SLUMP (in.): 4 1/2

CONC. TEMP. (F): 78

AIR TEMP. (F): 67

UNIT WT. (pcf): ---

MOLDED BY: CCT

***Testing conforms to ASTM C 172, C 231, C 143, C 1064, C 138, C 31, & C 39/C 39M

LAB NO.	BREAK DATE	AGE (days)	DIA. (in)	AREA (sq. in.)	LOAD (lbs)	COMPRESSIVE STRENGTH (psi)	TYPE OF FRACTURE
1430	08/06/21	7	4	12.56	52,040	4140	2
1431	08/06/21	7	4	12.56	51,020	4060	2
1432	08/27/21	28	4	12.56		0	
1433	08/27/21	28	4	12.56		0	

Cylinder Size: 4" x 8"


7 DAY AVERAGE

4,100


28 DAY SPEC.

3,500

Comments:

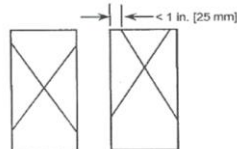

Type 1
Reasonably well-formed cones on both ends, less than 1 in. [25 mm] of cracking through caps

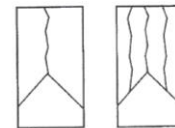


Type 2
Well-formed cone on one end, vertical cracks running through both ends, no well-defined cone on other end



Type 3
Columnar vertical cracking through both ends, no well-formed cones



Type 4
Diagonal fracture with no cracking through ends; tap with hammer to distinguish from Type 1

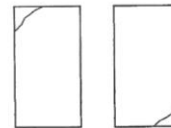

Type 5
Side fractures at top or bottom (occur commonly with unbonded caps)



Type 6
Similar to Type 5 but end of cylinder is pointed

Reviewed By:

Mitch Forst, President

Distribution: Century Cement

Typical Fracture Patterns